

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3885	DATE	September 1, 2016
MANUFACTURER	Mazda Motor Corporation		
DESCRIPTION OF DEFECT	On the diesel engine equipped, due to inappropriate control of the amount of the air intake on the power control module, in the cylinder, the fuel concentration may be high and much soot may occur at the combustion. Therefore, when the exhaust valve opens, the soot may go into around the exhaust side of the valve guide and accumulate. Then this may prevent the valve from operating smoothly, and the poor acceleration and vehicle vibration may be occurred by compression failure. In the worst case, the engine may not operate during driving.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
LDA-DK5AW	Mazda「CX-3」	2014-2016	13,329
LDA-DK5FW		2014-2016	31,783
LDA-DJ5AS	Mazda「Demio」	2014-2016	10,684
LDA-DJ5FS		2014-2016	59,375
LDA-BMLFS	Mazda「Axela」	2016	1,859
		Total	117,030