

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN NO.	3888	DATE	Sep. 9, 2016
MANUFACTURER	MITSUBISHI MAHINDRA AGRICULTURAL MACHINERY CO.,LTD.		
DESCRIPTION OF DEFECT	<p>On the rear axle shaft of the agricultural tractor, a crack probably occurs on the shaft under heavy load condition during some field operations due to improper heat treatment process of the shafts.</p> <p>Therefore, there is risk that the crack grows if operating the agricultural tractor under this situation continuously, the shaft breaks, and in worst case the agricultural tractor becomes unable to travel.</p>		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
SA-GX46	「GX40」	2006-2008	125
	「GX46」	2006-2008	98
SB-GX50	「GX50」	2006-2008	432
EDM-GT46E	「GX460」	2008-2010	158
KDN-GT51A	「GX461」	2010-2014	238
	「GX510」	2008-2010	391
	「GX511」	2010-2014	477
		TOTAL	1919