VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Omestic Import Vehicles

CAMPAIGN No.	3900	DATE	Oct. 18. 2016		
MANUFACTURER	Hino Motors, Ltd.				
DESCRIPTION OF DEFECT	transmission, due to piston which changes speed, the area which causing the outer pis gear. Therefore, the seal of the outer and the airtightness not gear change to take 1 the condition, the ge	On certain heavy duty buses equipped with an electric air type transmission, due to the improper end face form of an outer piston which changes an even number speed and an odd number speed, the area which receives air pressure may be insufficient, causing the outer piston to start operating late in changing the gear. Therefore, the outer piston may move rapidly and the cup seal of the outer and the inner piston may wear away, causing the airtightness not to be maintained, which may result in a gear change to take long. If it is continued to be used under the condition, the gear change may become impossible resulting the vehicle unable to move in the worst case.			

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
QRG-RU1ASCA QRG-RU1ASCAKAI QTG-RU1ASCA	[HINO SELEGA]	2012~2014	851
		TOTAL	851