

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	3901	DATE	October 18 ,2016
MANUFACTURER		ISUZU MOTORS LIMITED	
DESCRIPTION OF DEFECT		<p>On certain heavy duty buses equipped with an electric air type transmission, due to the improper end face form of an outer piston which changes an even number speed and an odd number speed, the area which receives air pressure may be insufficient, causing the outer piston to start operating late in changing the gear. Therefore, the outer piston may move rapidly and the cup seal of the outer and the inner piston may wear away, causing the airtightness not to be maintained, which may result in a gear change to take long. If it is continued to be used under the condition, the gear change may become impossible resulting the vehicle unable to move in the worst case.</p>	

TYPE	COMMERCIAL NAME	MODELYEAR RECALLED	NUMBER OF VEHICLE
QRG-RU1ASCJ	[ISUZU GALA]	2012-2014	499
		TOTAL	499