## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3917	DATE	October.27. 2016
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	Front fork may have an inadequately surface-treated pivot arm bush. If this situation causes premature wear of the O-ring between the bush holder and the bush and grease leakage is thereby caused, frictional resistance between the front pivot arm and the bush side surface may increase. If the vehicle continues in service in such a condition, the right front pivot arm will be excessively stressed and can be thereby broken. If the worse came to the worst, the front brake cable could be pulled upon application of the front brake, causing the front wheel to lock whereby the vehicle could be fallen over or disabled.		

TYPE	COMMERCIAL	MODEL YEAR	NUMBER OF
	NAME	RECALLED	VEHICLE
JBH-TD02	GYRO X	2011~2015	12,580
		2011~2015	228
		2012~2015	438
		TOTAL	13,246

## THOSE DELIVERED AS "REPLACEMENT/SERVICE PARTS"

PARTS	PART NO.	DELIVERED AS "SERVICE PARTS"	NUMBER OF PARTS
	51110-GFY-630		
FRONT FORK	51110-GFY-660	2011~2016	5,873
ASSEMBLY	51110-GM6-316		
	51110-GG2-316		
	51314-GFY-661		
PIVOT ARM BUSH	51314-GM6-000	2012~2016	6,652
	51314-GG2-900		
		TOTAL	12,525