

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

(Domestic) Import Vehicles

CAMPAIGN No.	3 9 4 1	DATE	N o v . 2 9 . 2 0 1 6
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>①Due to an inappropriate tightening of the cylinder head in the motor, some cylinder head gaskets have a poor airtightness. Because of that, when a high load is put on while running at high speed, etc., the airtightness of the cylinder head gasket may be damaged and the cooling water may infiltrate into the combustion chamber causing the ignition plug to get wet. In the worst case scenario, an engine stall may occur while idling, or the engine may not start.</p> <p>②Due to an inappropriate attachment of the clamp that is to fix the electric wire of the speed sensor to the brake hose in the speedometer, when the handle is repeatedly operated, the position of the clamp may be shifted from the correct attachment position. Because of that, the wiring of the electric wire for the speed sensor may be changed, and therefore, if it is used continuously, the said electric wire may be bent. In the worst case scenario, the wire may be disconnected and the speedometer may not activate.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
J B K - S G 2 8 J	M A J E S T Y S X C 1 5 5	2 0 1 3 ~ 2 0 1 6	2 0 , 1 6 6
		T O T A L	2 0 , 1 6 6