

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	3946	DATE	November 30, 2016
MANUFACTURER	Unicarriers		
DESCRIPTION OF DEFECT	<p>In the engine mounting insulator of forklift, stud bolt has an insufficient strength, due to lack of heat treatment in the manufacturing process. Thus, stud bolt will be stretched by nut tightening and loses its axial force capability. If it is used continuously in the same condition, nut loosening may be caused by engine vibration and other factors, and in worst case, the nut would be removed and the engine would be tilted, then there is a possibility that propeller shaft may be damaged which makes it incapable to transmit power causing travelling impossible.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
YDM-F177	UNICARRIERS FORKLIFT	2 0 1 5	494
YDN-F178		2 0 1 6	
YDM-F180			
YDN-F181			
EBT-F175			
EBT-F175L			
EBT-F176			
EBT-F176L			
EBT-F179			
EBT-F179L			
YDM-F184			
YDN-F185			
YDM-F187			
YDN-F188			
EBT-F183			
EBT-F183L			
EBT-F186			
EBT-F186L			
		TOTAL	494