

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3 9 5 8	DATE	Dec.15.2016
MANUFACTURER	N I S S A N		
DESCRIPTION OF DEFECT	<p>In an ABS actuator, because the temperature management at the oil seal molding in the gear pump is inappropriate, there are some oil seals which the hardness is low. Therefore, brake fluid infiltrates into the oil seal and seal performance decreases, if the vehicle continues to be driven in this condition, the brake fluid may leak in the actuator, and if the brake fluid will ingress into electricity board, ABS and VDC warning light turn it on by the system abnormality, and the function will be stopped, in an extern case, the electrical short in the actuator circuit will be generated and it may lead to a fire.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
DAA-HNT32	X-TRAIL	2015	15,549
DAA-HT32			2,569
		TOTAL	18,118