

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.		3959	DATE	December 21 .2016
MANUFACTURER		YANMAR CO.,LTD.		
DESCRIPTION OF DEFECT		<p>① Planetary shaft at planetary gear in continuously variable transmission was mounted improperly. It may let spring pin slip out turning on the field, which generates excessive load on the shaft as well as crack. Operation with this condition could expand the crack to break the shaft, then shaft may fall off to get into gears, which could result in becoming unable to travel in the worst case.</p> <p>② In transmission system, travel tension arm is improperly designed to have insufficient strength against load fluctuation under engine with high rating rotation. This could concentrate stress on the welded part to generate crack. Operation with this condition may expand the crack to break tension arm, which might prevent from power transferring and result in becoming unable to travel in worst case.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EDM-C34D	「 AE330 」	2010-2013	1413
	「 AE334 」	2010-2013	698
	「 AE434 」	2010-2013	398
EDM-C39	「 AE439 」	2010-2013	908
—	「 AE445 」	2011-2014	500
	「 AE447 」	2012-2013	610
TOTAL			4525