

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

(Domestic) / Import Vehicles

CAMPAIGN No.	3 9 8 9	DATE	F e b . 1 4 . 2 0 1 7
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>①Due to the inappropriate material that was used for the contact plate of the ignition switch, when water infiltrates inside the ignition switch while washing the vehicle, etc., the contact points may become corroded.</p> <p>Because of that, if it is used continuously, a contact failure may occur in the ignition switch, and in the worst case scenario, the motor may stop while running.</p> <p>②As for the fuel device, due to the inappropriate position of the hole to attach the bracket that fixes the fuel tank onto the frame, the fuel tank may not be attached to the correct position, and because of that, the vibration which was generated by the engine may be conveyed to the fuel tank through the bracket.</p> <p>Therefore, the fuel tank and the stay may resonate with each other creating cracks in the area where the stay and the fuel tank were welded. In the worst case scenario, the fuel may leak.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EBL-RH07J	YZF-R3A	2015~2016	2,188
	MT320		1,255
JBK-RG10J	YZF-R25	2014~2016	10,294
	YZF-R25A	2015~2016	2,683
	MT250		3,487
		TOTAL	19,907