

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4 0 0 9	DATE	M a r . 2 1 . 2 0 1 7
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>The amount of application of slack preventive agent for some of the stud bolts used on the handle holder at the bottom of the steering device is insufficient. Furthermore, due to inappropriate paint instructions for the seating face of the said holder, the paint on the seating face may peel when a big force is put on the seating face repeatedly such as riding across a level difference at a fast speed, etc.</p> <p>Because of that, if it is used continuously, the axial force of the stud bolt may go down and as a result, the stud bolt may come off and the handle may become impossible to operate.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EBL-RN34J	MT-09	2014~2016	2,651
	MT-09A	2014~2016	5,208
EBL-RN36J	MT-09TRA	2015~2016	3,653
EBL-RN46J	XSR900	2016	2,440
		TOTAL	13,952