VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	4 0 4	2	DATE	April 1	4, 2017
MANUFACTURER	ISEKI & CO., LTD.				
DESCRIPTION OF DEFECT	①For the engine of the harvester combines, because the cooling system is inappropriate, the variation in temperature of cooling water increase, and the friction occurs between the cylinder head and the gasket by repeated thermal expansion and contraction of the cylinder head, and the cylinder head may be worn out. Therefore, the combustion gas enters the cooling water line by loss of the gasket function, and the cooling water blows out when the combustion gas reaches the reservoir tank of the cooling water. In the worst case scenario, the harvester combines overheats by loss of the cooling water. ②For the engine of the harvester combines, because an installation of EGR pipe is inappropriate, assembly load on the stay of EGR pipe occurs and the stay may be cracked by vibration of the engine. Therefore, the use in the condition may lead to damage the stay, and in the worst case scenario, the exhaust gas leaks by cracks in the flange.				
ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED		NUMBER OF VEHICLE	
WDP-H161	ГНЈ5098GЈ	2014-2016		167	①165 ②167
	ГНЈ6098GЈ	2014-2017		192	①187 ②192
			TOTAL	359	①352 ②359