

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4036	DATE	May. 18, 2017
MANUFACTURER	SUBARU CORPORATION		
DESCRIPTION OF DEFECT	<p>Due to improper fitting structure of a roof rail front cover, front cover fitting claws might be damaged when it was installed to the vehicle body in the assembly line.</p> <p>During usage of the vehicle, the damage may grow when an external force was applied to the cover and the cover may be loose.</p> <p>In the worst case, the cover may come off during driving and the separated roof rail front cover may become a road hazard.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-YAM	「EXIGA」	2015~2016	5,227
		TOTAL	5,227