

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

(Domestic) / Import Vehicles

CAMPAIGN No.	4 0 5 6	DATE	J u n . 6 . 2 0 1 7
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>Due to an inappropriate nature of the protective material that is covering the soldered section inside the crank position sensor of the motor, the engine oil may infiltrate the sensor and become attached to the copper wire. Because of that, when the sensor is heated up due to running on a busy highway, etc., the copper wire may become corroded due to the engine oil compounds.</p> <p>In the worst case scenario, the copper wire may be disconnected and as a result, the engine may stall while running or the engine may not start.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
E B L - V H 0 2 J	XVS400 DRAGSTAR	2 0 0 9 ~ 2 0 1 6	2, 4 9 4
	XVS400C DRAGSTAR CLASSIC		2, 7 9 7
		TOTAL	5, 2 9 1