

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

~~Domestic~~ /Import Vehicles

CAMPAIGN No.	Gai-2491	DATE	July 3, 2017
MANUFACTURER	Automobiles Volvo Car Corporation (Japanese Importer: Volvo Car Japan Limited)		
DESCRIPTION OF DEFECT	Specific batches of the pump plunger spring may generate higher side loads. In combination with low cooling, due to short distance driving in high ambient temperatures, the low fuel flow causes poor lubrication of the injection pump plunger. This may cause the injection pump to seize. The corrective action is to replace the injection pump.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
VOLVO	[V40]	2015-2017	2700
	[V40CC]	2015-2017	956
		TOTAL	3656