

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	4084	DATE	July 31 ,2017
MANUFACTURER		ISUZU MOTORS LIMITED	
DESCRIPTION OF DEFECT		<p>On certain Heavy- and Medium-duty Route Buses, because of the inadequate protection of the end part of the connecting member for the switch box under the driver's seat and the driver's side wall panel, the said end part and wire may interfere with each other. As a result, the continued use may damage the insulation of the wire to short-circuit, and in the worst case, the engine will be in danger of stopping while the bus is moving and being unable to restart.</p> <p>On certain Heavy-duty Route Bus, as the harness routing inside the driver side wall panel is inappropriate, the wire may interfere with the end part of the panel bracket. Because of this, the continued use may damage the insulation of the wire to short-circuit, and in the worst case, the door operating mechanism may not function.</p>	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
QDG-LV290N1 QKG-LV290N1 QPG-LV290N1	[ERGA]	2015-2017	828
QKG-LV290Q1 QPG-LV290Q1 QRG-LV290Q1		2015-2017	241
SKG-LR290J2	[ERGA MIO]	2016-2017	188
		TOTAL	1,257