

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

RECALL No.	Gai-2510	DATE	Aug. 4. 2017
MANUFACTURER	Ford Motor Company (Japanese Importer: Ford Japan Limited)		
DESCRIPTION OF DEFECT	<p>In some of the affected vehicles, the electronic throttle body (ETB) internal motor contacts may develop contamination resulting in increased electrical resistance. If this condition is present, the wrench light or malfunction indicator lamp will illuminate and the vehicle may enter a Failure Mode Effects Management (FMEM) of default throttle position with fixed RPM. In this mode, while engine power and vehicle speed are reduced, the power steering, power braking, lighting, and climate control systems are maintained.</p> <p>SERVICE ACTION : Dealers are to replace the ETB. This service must be performed on all affected vehicles at no charge to the vehicle owner.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR FIELD SAERVICE ACTION	NUMBER OF VEHICLE
ABA-1FM5K8	Explorer	2016	82 units
Unknown	Mustang	2011	36 units
Unknown	Lincoln MKX	2011	15units
TOTAL			133 units