

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4112	DATE	September 15, 2017
MANUFACTURER	UD TRUCKS CO.,LTD.		
DESCRIPTION OF DEFECT	<p>The maximum value of the vehicle height adjustment device is improperly set. In respect of the specifications of heavy duty truck's dual rear axles air suspension, when a vehicle is lifted up to its maximum height due to loading, unloading and other activities, the length of a rear-rear axle shock absorber may be stretched to an extent exceeding its maximum limit, which could cause deformation of its internal parts and resulted in such shock absorber being not able to slide back to its original position smoothly even after the vehicle is lowered down. When a vehicle continues to be operated under the above condition, the piston rod of the shock absorber may break and interfere with the air-spring, which might cause air leakage. Separately, the shock absorber might also interfere with tires and causing a tire burst. In the worst case scenario, there may be a risk of fire due to the heat generated in the above process.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2PG-CD5CA	UD Trucks Quon	2017	20
2PG-CG5CA	UD Trucks Quon	2017	27
2PG-CW5CA	UD Trucks Quon	2017	3
		TOTAL	50