

VEHICLE SAFETY RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4109	DATE	Sep 28, 2017
MANUFACTURER	SUZUKI MOTOR CORPORATION		
DESCRIPTION OF DEFECT	<p>On an electric power steering controller, because fitment of wiring harness to controller was improper, terminals between controller and wiring harness get worn by driving vibration, and insulator products are generated by fretting corrosion, causing poor electrical conductivity.</p> <p>If no electrical conductivity is observed, warning light comes on, steering assist force does not work, and steering operation force becomes heavy.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
DBA-MK21S	PALETTE	2008~2013	278,383
CBA-MK21S			62,045
DBA-ML21S	ROOX	2009~2013	164,021
CBA-ML21S			9,373
DBA-MM21S	FLAIR WAGON	2012~2013	5,708
CBA-MM21S			121
		TOTAL	519,651