

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	4651	DATE	January 30 ,2020
MANUFACTURER		ISUZU MOTORS LIMITED	
DESCRIPTION OF DEFECT		<p>(1)Regarding some light-duty truck engines, the engine control program in a high-revolution and high-load condition is inappropriate. Therefore, hot and cold damage may accumulate at the mouth of the combustion chamber of the pistons, which may cause cracks. Consequently, if the trucks are continuously used without repair, the cracks may develop into holes, and cause engine output declines and white smoke emissions, which, in the worst case, could make the vehicles undrivable.</p> <p>(2)Regarding some fuel injection systems in the light-duty trucks, the tightening force of the bolts to attach the supply pump to the engine is insufficient. Consequently, the tightening portions may come loose due to such factors as running vibration, causing the vibration of the supply pump to increase. In the worst case, the fuel pipes could crack, potentially leading to fuel leakage.</p>	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
SKG-NKR85YN	[ELF]	2011-2014	2,559
SDG-NPR85AN SJG-NPR85AN SKG-NPR85AN SKG-NPR85AR SQG-NPR85AN TKG-NPR85AN TKG-NPR85AR TQG-NPR85AN		2011-2015	22,728
SKG-NPR85YN		2011-2014	7,809
SDG-NPS85AN SDG-NPS85AR SKG-NPS85AN SKG-NPS85AR TDG-NPS85AN TDG-NPS85AR		2011-2014	1,683
SKG-AKR85YN		[ATLAS]	2011-2012
SJG-APR85AN SKG-APR85AN SKG-APR85AR TKG-APR85AN TKG-APR85AR TQG-APR85AN	2011-2012		444

TYPE	COMMERCIAL NAME	MODELYEAR RECALLED	NUMBER OF VEHICLE
SKG-APR85YN	[ATLAS]	2011-2012	64
SDG-APS85AN SDG-APS85AR TDG-APS85AN TDG-APS85AR		2011-2012	41
SKG-BKR85YN	[CONDOR]	2012-2014	13
SKG-BPR85AN SKG-BPR85AR TKG-BPR85AN TKG-BPR85AR		2011-2014	204
SKG-BPR85YN		2011-2014	105
SDG-BPS85AN SDG-BPS85AR TDG-BPS85AN TDG-BPS85AR		2011-2014	39
SKG-LKR85YN		[TITAN]	2011-2014
SKG-LPR85AN SKG-LPR85AR TKG-LPR85AN TKG-LPR85AR	2011-2014		837
SKG-LPR85YN	2011-2014		192
SDG-LPS85AN SDG-LPS85AR TDG-LPS85AN TDG-LPS85AR	2011-2014		42
			TOTAL

Vehicles Which Had The Affected Parts Installed After They Rolled Off The Assembly Line

TYPE	COMMERCIAL NAME	MODELYEAR RECALLED	NUMBER OF VEHICLE
SKG-NPR85AN TKG-NPR85AN TQG-NPR85AN	[ELF]	2011-2012	38
TDG-NPS85AN		2012	1
		TOTAL	39

The Affected Parts Shipped As Repair Parts, But The Vehicles With Them Installed, Cannot Be Identified.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF VEHICLE
4JJ1 ENGINE	8-98075461-0 8-98075465-0 8-98075467-0 8-98075475-0 8-98075477-0 8-98217857-0 8-98217858-0	2013-2016	47
		TOTAL	47