

## VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	4731	DATE	31-Mar, 2020
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	In the front axle of shovel loader, cracks may occur inside the axle shaft due to insufficient control of the hydrogen content in the steel material manufacturing process of the axle shaft, and in the worst case, the axle shaft may be broken and the front tires may fall off.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDS-WA129	「WA470-8」	2020	3
		TOTAL	3