

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4730	DATE	Apr.8.2020
MANUFACTURER	TOYOTA		
DESCRIPTION OF DEFECT	In the back door wire harness of the subject vehicles, due to an improper equipment for the conductivity inspection of the wire harness in the back door assembly process, there is a possibility that terminals of the wire harness could be deformed causing contact pressure to become lower. In this condition, an oxide layer may develop on the surface of the terminals by influence of temperature and moisture, resulting in conduction failure at the terminals. If this occurs, the backup lamp will become inoperative.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
6AA-ZWE211H	[COROLLA SPORT]	2019	241
3BA-NRE210H			148
3BA-NRE214H			38
		TOTAL	427