

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4734	DATE			16-Apr-20
MANUFACTURER	KUBOTA Corporation				
DESCRIPTION OF DEFECT	<p>①At the agricultural tractor, an inappropriate wiring of wire harness can cause the wire harness interference with the edge of the stay of the hydraulic pipes. Due to the running vibration, damage on the wire insulation will occur and can cause a shorts circuit. In the worst case it may lead to fire.</p> <p>②At the agricultural tractor, protruding of the engine stud bolt near the wire harness can cause the wire harness interference with the top of the stud bolt. Due to the running vibration, damage on the wire insulation will occur and can cause a shorts circuit. In the worst case it may lead to fire.</p> <p>③At the agricultural tractor, an inappropriate wiring of wire harness can cause the wire harness interference with the edge of the relay and fuses bracket. Beside that, the wire harness will interference each others. Therefore due to vibration, the wire harness may be shorted. In the worst case it can lead to posing a fire hazard to consumers.</p> <p>④At the agricultural tractor, an inappropriate wiring of wire harness can cause the wire harness interference with the edge of the power steering controller bracket. Due to the running vibration, damage on the wire insulation will occur and can cause a shorts circuit. In the worst case it may lead to fire.</p>				
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	REMARKS	
SB-M95X	「M85D」	2005~2008	70	①,②,③	
	「M95D」	2004~2008	267	①,②,③	
SC-M105X	「M105D」	2004~2008	683	①,②,③	
-	「M105D-HPC」	2004~2008		①,②,③	
SC-M125X	「M115D」	2004~2008	113	④	
	「M125D」	2004~2008	398	④	
-	「M125D-HPC」	2004~2008			④
SB-M95X	「GR850」	2005~2008	20	①,②,③	
	「GR950」	2005~2008	25	①,②,③	
SC-M105X	「GR1050」	2005~2008	73	①,②,③	
SC-M125X	「GR1150」	2005~2008	9	④	
	「GR1250」	2005~2008	8	④	
TOTAL			1666	①,②,③1138 ④528	