

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4741	DATE	Apr.24 2020
MANUFACTURER	KATO WORKS CO.,LTD.		
DESCRIPTION OF DEFECT	<p>Due to the improper shape of the part, which is fixed to the end of boom-retracting wire rope, there is a possibility that the retracting wire rope might be in contact with the rope-guide.</p> <p>When machine used under such condition, fixing bolts of rope-guide may get broken or loosen. In worst cases, rope-guide may drop off and be clamped by boom sections, therefore the boom cannot be fully retracted. In such case, the full length of vehicle may not remain within the relaxed standard length, hence a violation of the standard safety regulation.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	Note
UDS-KRC012	KR-75H	2013~2016	447	
YDS-KRC018	KR-80H	2017~2020	358	
TOTAL			805	