VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN



CAMPAIGN No.	4673	DATE	2020.4.28	
MANUFACTURER	YANMAR CONSTRUCTION EQUIPMENT CO. ,LTD.			
DESCRIPTION OF DEFECT	Oil seal is deformed since the oil seal assembly for the position of shovel loader/front axle is improper. If they continue to use under the same condition, there is a possibility that oil leaks from the position the oil seal is attached. And there is no possibility of fire because it will not attach to the muffler etc.			

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDM-V37	[V3-7]	2019	81
YDM-V47	[V4-7]	2019	107
YDM-V57	[V5-7]	2019	5
RV06	「LK40ZST-6」	2019	2
YDM-RW06	「LK40Z-6」	2019	5
YDM-RX06	「LK50Z-6」	2019	35
TOTAL			235