VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4764	DATE	Jun.24.2020		
MANUFACTURER	TOYOTA				
DESCRIPTION OF DEFECT	In the headlamps of the subject vehicles, there is a possibility that, if the headlamps are activated continuously for a long period of time beyond supposition, such as in taxi use applications, the aluminum coating layer of the headlamp reflectors could peel over time from heat exposure and ultraviolet rays which are emitted from the headlamp bulbs. If the vehicle is continuously operated in this condition, the collection of light become insufficient and the luminous intensity of the headlamp could gradually decrease, and in the worst case, the luminous intensity may not comply with the requirement prescribed in "Safety Regulations for Road Vehicles", Article 32 (requirement of headlamps).				

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DBA-GRS210	[CROWN]	2013-2015	22	for commercial
DBA-GRS211			4	use
DBA-GRS214			2	
DAA-AWS210			193	
DAA-AWS211		2014-2015	7	
		TOTAL		228