VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4769	DATE	Jun.30 2020
MUNUFACTURER	Mitsubishi Fuso Truck and Bus Corporation		
DESCRIPTION OF DEFECT	On certain steel disc wheels of heavy duty trucks, due to the improper die of the rim forming step, the rim and the disc welding mating face may become uneven, making the fatigue strength of the welded portion insufficient. Therefore, if it is used for a long time, the welded portion may crack, resulting in damage of the disc wheel in the worst case.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2PG-FU74HZ	「FUSO SUPER GREAT」	2020	1
		TOTAL	1