

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIN No.	Gai-3061	DATE	24 August, 2020
MANUFACTURER	Dr. Ing. h.c. F. Porsche AG (Japanese Importer: Porsche Japan KK)		
DESCRIPTION OF DEFECT	<p>There is the possibility, that the screw joints of the four-wheel final drive to the transmission mount have not been tightened according to the specifications on the affected vehicles due to a process error at the supplier.</p> <p>If this is the case, the screw joints between the four-wheel final drive and the mount possibly may become loose after a short runtime. A loose four-wheel drive causes pronounced knocking noises and vibrations at the vehicle's front, which can be recognized by the vehicle's occupants where appropriate.</p> <p>If the vehicle will be used on nevertheless, the four-wheel final drive might move beyond the installation position, subsequently causing damages of surrounding parts, e.g. the fuel tank or the drive shafts. If the fuel tank will be damaged accordingly, a spill of fuel could happen. In combination with an ignition source, a fire hazard cannot be excluded.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
3BA-992L30	911 Carrera 4S	2020	2
		TOTAL	2