VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4798	DATE	September 3,2020	
MANUFACTURER	MITSUBISHI MOTORS CORPORATION			
	Strength of the radiator chamber for engine cooling system (a system			
	which separates the bubbles in the cooling water) is insufficient. If the			
	engine is stopped soon after the vehicle with loads is driven at high			
DESCRIPTION	speed or at high rpm or on a slope upwards, and if this operation is			
OF DEFECT	performed repeatedly, sometimes the insufficiency can be the cause of a			
	crack which leads to a leakage of cooling water. If the vehicle is			
	continued to be driven, there is a risk of the engine overheating, and in			
	the worst case, the engine stops and may not be able to restart.			

MX D E	COMMERCIAL	MODEL YEAR	NUMBER OF
ТҮРЕ	NAME	RECALLED	VEHICLE
GD-U61T GD-U61TP		1998~2003	47,297
LE-U61T LE-U61TP	「MINICAB」	2002~2004	19,851
GBD-U61T GBD-U61TP		2004~2005	10,602
GD-U62T GD-U62TP		1998~2002	69,251
LE-U62T LE-U62TP		2002~2004	26,993
GBD-U62T GBD-U62TP		2004~2005	14,129
GD-U61V		1998~2003	60,030
LE-U61V		2002~2004	32,735
GBD-U61V		2004~2006	14,521
EBD-U61V		2011~2013	965
GD-U62V		1998~2003	28,491
LE-U62V		2002~2004	11,906
GBD-U62V		2004~2005	5,884
EBD-U62V		2011~2013	1,269
GF-U61W	「TOWNBOX」	1999~2002	11,045
TA-U61W		2002~2004	4,858
ABA-U61W		2004~2011	4,103
CBA-U61W		2004~2005	1,610
GF-U62W		1999~2002	8,203
TA-U62W		2002~2004	4,195
ABA-U62W		2004~2011	4,653

CBA-U62W	「TOWNBOX」	2004~2005	403
GF-U63W		1999~2002	5,395
GF-U64W		1999~2002	6,762
GF-U65W	「TOWNBOX WIDE」	1999~2001	2,195
GF-U66W		1999~2001	1,819
LE-U71T LE-U71TP	「CLIPPER」	2003~2004	5,113
GBD-U71T GBD-U71TP		2004~2005	5,239
LE-U72T LE-U72TP		2003~2004	6,099
GBD-U72T GBD-U72TP		2004~2005	5,208
LE-U71V		2003~2004	9,964
GBD-U71V		2004~2005	10,005
EBD-U71V		2012~2013	1,693
LE-U72V		2003~2004	4,357
GBD-U72V		2004~2005	3,881
EBD-U72V		2012~2013	865
ABA-U71W	CLIPPER RIO	2007~2011	3,468
ABA-U72W		2007~2012	1,546
		TOTAL	456,603