

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN No.	Gai-3094	DATE	Sep. 14 th , 2020
MANUFACTURER	BMW (Japanese Importer: BMW Group Japan Corp.)		
DESCRIPTION OF DEFECT	The fuel tank may have a welding fault on the lid of the mounting hole for the suction jet pump. Due to driving vibration etc., this may lead to the formation of cracks at the weld seam, where the fuel may leak from.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-1A16	BMW 116i	2013 - 2016	5,466
	BMW 118i		2,952
	BMW 120i		779
DBA-1R15	BMW 118i	2015 - 2016	4,284
DBA-1B30	BMW M135i	2012 - 2016	1,596
DBA-1J20	BMW 220i	2014 - 2016	1,649
DBA-1J30	BMW M235i	2013 - 2016	1,299
DBA-3B20	BMW 320i	2012 - 2015	9,421
DBA-8A20	BMW 320i	2015 - 2016	3,688
	BMW 330i		85
DBA-3X20	BMW 320i GranTurismo	2013 - 2016	3,981
DBA-3A20	BMW 328i	2012 - 2015	597
DBA-3X28	BMW 328i GranTurismo	2013 - 2016	389
DBA-3A30	BMW 335i	2013 - 2015	255
DBA-3X30	BMW 335i GranTurismo	2013 - 2016	263
DBA-8B30	BMW 340i	2015 - 2016	251
DAA-3F30	BMW ActiveHybrid 3	2012 - 2015	2,090

DBA-3N20	BMW 420i	2013 - 2016	2,238
DBA-4N20	BMW 420i	2016	72
	BMW 430i		12
DBA-4A20	BMW 420i GranCoupe	2014 - 2016	3,190
DBA-4D20	BMW 420i GranCoupe	2016	338
	BMW 430i GranCoupe		12
DBA-3N28	BMW 428i	2013 - 2016	509
DBA-4A28	BMW 428i GranCoupe	2014 - 2016	234
DBA-3R30	BMW 435i	2013 - 2016	1,715
DBA-4B30	BMW 435i GranCoupe	2014 - 2016	568
DBA-4P30	BMW 440i	2016	23
DBA-4E30	BMW 440i GranCoupe	2016	12
CBA-1H30	BMW M2	2015 - 2016	158
CBA-3C30	BMW M3	2014 - 2016	672
	BMW M4		1,341
		TOTAL	50,139