

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4815	DATE	Oct. 1. 2020
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>①With regard to the brakes for the buses, as materials used for plastic pistons in relay valves for parking brakes are inappropriate, the pistons may be hydrolyzed by moisture in the air circuits and damaged by brake air pressure. Consequently, this may potentially lead to air leakage from brake valves, parking brakes being unreleasable, and brake drag.</p> <p>②With regard to the exhaust gas diffusing prevention devices of the buses, due to the improper engine control program to regenerate DPD (Diesel Particulate Defuser), a part of the DPD regeneration fuel may burn in the downstream of DPD and raise the exhaust gas temperature near the urea SCR (Selective Catalytic Reduction). Consequently, the radiant heat may melt the diesel exhaust fluid hoses and other parts, potentially causing diesel exhaust fluid to leak out and nitrogen oxide (NOx) in the exhaust gas to exceed the exhaust gas standard level. "</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	REMARK			
QDG-KV290N1	[HINO BlueRibbon]	2015~2017	355	①179			
QKG-KV290N1				②355			
2DG-KV290N2		2017~2019	242	①242			
2KG-KV290N2							
2TG-KV290N2							
2DG-KV290N3							
2KG-KV290N3		2019	27	①27			
2TG-KV290N3							
QKG-KV290Q1							
QPG-KV290Q1		2015~2017	294	①132			
QRG-KV290Q1					②294		
2DG-KV290Q2							
2KG-KV290Q2		2017~2019	282	①282			
2PG-KV290Q2							
2TG-KV290Q2							
2PG-KV290Q3							
2TG-KV290Q3	2019	45	①45				
SKG-KR290J2				[HINO Rainbow]	2016~2017	202	①202
2KG-KR290J3					2017~2019	389	①389
2KG-KR290J4	2019	57	①57				

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	REMARK
QSG-HL2ANAP	[HINO BlueRibbon Hybrid]	2016~2017	34	①34
2SG-HL2ANBP		2017~2019	132	①132
QSG-HL2ASAP		2016~2017	23	①23
2SG-HL2ASBP		2017~2019	54	①54
KX525Z1	[—]	2019	3	①3
TOTAL			2,139	①1,801 ②649

The affected parts shipped as repair parts, but the vehicles with them installed, cannot be identified.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF PARTS	REMARK
RELAY VALVE	SX001-16430	2016~2020	126	①
RELAY VALVE REPAIR KIT	SX001-16054	2016~2020	714	①
TOTAL			840	