VEHICLE SAFETY RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4845	DATE	Nov. 19, 2020	
MANUFACTURER	SUZUKI MO'	FOR CORPOR	ATION	
DESCRIPTION OF DEFECT	Due to the improper control of the manufacturing process of the discharge (HID) head lamp, the volatile compound of silicon may contaminate the packing seal in the head lamp socket. The silicon compound may vaporize by the heat from the light bulb and it may become vapor deposition stuck on the HID bulb socket contact surface. Due to the arc discharge heat in the contact surface, the vapor deposition of the silicon compound then turns into the oxide silicon that may lead to the conduction failure and the head lamp malfunction.			

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
DBA-MR31S	HUSTLER	2013~2015	95,590
DAA-MR41S	HUSILER	2015~2018	144,885
DBA-HE33S	ALTO LAPIN	2015 2018	73,594
DBA-MS31S	FLAIR	2014~2015	14,215
DAA-MS41S	CROSSOVER	2015~2018	15,593
		TOTAL	343,877