

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4876	DATE	2021/1/15
MANUFACTURER	KUBOTA Corporation		
DESCRIPTION OF DEFECT	At the fuel filter bracket of the agricultural tractor may be damaged due to lack of strength. Therefore, in the worst case, the fuel hose may be caught in the cooling fan and broken, so that the fuel may be scattered in the bonnet and white smoke (a mist of light oil) may be released from the engine room.		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
XDN-MRX YDN-MRX	MR60 MR60-PC	2015~2020	383
	MR65 MR65-PC	2015~2020	945
	MR70 MR70-PC	2015~2020	978
YDN-MWY	M720W	2017~2020	247
XDN-MRX YDN-MRX	GV60 GVK60	2015~2020	55
	GV65 GVK65	2015~2020	83
	GV70 GVK70	2015~2020	96
	T2.65	2015~2020	439
		TOTAL	3226

[Notes]

The range of vehicle numbers for recalled vehicles may include vehicles that are not.

This case was a recall notification with the notification number "4490" on April 24, 2019, but a new cause has been identified, a new notification will be made.