

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic

CAMPAIGN No.	4928	DATE	March 31, 2021
MANUFACTURER	UD Trucks Corporation		
DESCRIPTION OF DEFECT	With regards to the in-take-air-pre-heater which supports engine startability in low temperature conditions, due to insufficient deaerating work during the waterproof and rust-prevention of the pre-heater-relay manufacturing process, in rare cases, air bubbles may remain on the circuit board within which micro-gas may be generated due to increased temperature. Thus, chemical reaction occurred by such micro-gas might lead the relay to become short-circuit which allows electricity to flow on the circuit board continuously, which leads to activating the warning display. In the worst case, the pre-heater-relay might overheat and may have a risk of heat damage or fire.		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2PG-CG5CA	Quon	2019 - 2020	6
			6