

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/~~Import~~ Vehicles

CAMPAIGN No.	4968	DATE	June 11, 2021
MANUFACTURE	SUMITOMO NACCO FORKLIFT CO., LTD. (Japan)		
DESCRIPTION OF DEFECT	As the shape of battery connector bracket is inappropriate, the clearance between the battery disconnect lever and the battery connector is insufficient and the clearance further reduced due to the deflection of the battery cover, so the battery disconnect lever may interfere with the battery connector. Therefore, the battery connector may cause contact failure and the connector may melt or the trucks may not run due to loss of power supply, and then the trucks may not be restarted if the trucks continue to be used as it is.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ZAF-SB1L	「FB09PXIII」 「FB10PXIII」 「FB15PXIII」 「FB18PXIII」 「FB20PXIII」	2016 - 2021	317
		TOTAL	317