

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4 9 8 9	DATE	July. 15. 2021
MANUFACTURER	N I S S A N		
DESCRIPTION OF DEFECT	<p>Regarding the automatic transmission, rivets may be broken due to insufficient strength by inappropriate dimensions of rivets fixing the lockup clutch of the torque converter. It cannot be in the lockup state in the the torque converter and the warning lamp will turn on because the broken rivet pieces will cause the friction material to be worn abnormally and cause other issue. In the worst case, the oil strainer will be clogged with wear debris and then the oil pressure made by the oil pump will be insufficient. This may cause the vehicle not to be able to drive.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
LDF-CW4E26	N I S S A N N V 3 5 0 C A R A V A N	2 0 1 7 ~ 2 0 1 9	1, 141
LDF-CW8E26			2, 611
LDF-DW4E26			262
LDF-VW2E26			15, 517
LDF-VW6E26			12, 435
LDF-JCW4E26	I S U Z U C O M O		18
LDF-JCW8E26			11
LDF-JVW2E26			156
LDF-JVW6E26			150
		TOTAL	32, 301