

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-3257	DATE	Jul. 20 2021
MANUFACTURER	Mercedes-Benz (Japanese importer : Mitsubishi Fuso Truck and Bus Corporation)		
DESCRIPTION OF DEFECT	<p>On some articulated buses, the following problems may occur:</p> <p>(1) Some of the piston mounting bolts for the air springs on the axles are not tightened to the specified torque. Therefore, the mounting bolts may loosen during use and the pistons may fall off.</p> <p>(2) Some of the mounting bolts for the wheel hub carriers on the center axle are not tightened to the specified torque. Therefore, the mounting bolts may loosen during use, and in the worst case, tires may fall off together with the wheel hub carriers.</p> <p>(3) Due to the inappropriate control program for the after control module, the warning light does not turn on when the urea water temperature sensor fails. Therefore, the driver cannot know the failure of the sensor.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
Unclear model	「Citaro-G」	2016~2020	33
		TOTAL	33