

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5015	DATE	Sep.16 2021
MUNUFACTURER	Mitsubishi Fuso Truck and Bus Corporation		
DESCRIPTION OF DEFECT	On some light-duty trucks, due to improper production work process of the engine, the fuel return hose is pinched between the oil filter and the oil level gauge guide and crushed. If the vehicle continues to be used, the fuel return hose may come off and fuel may leak. In the worst case, a fire will occur.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2PG-FEB80	「FUSO CANTER」	2021	1
2PG-FEB90		2021	1
2RG-FBA20		2021~2021	13
2RG-FBA30		2021~2021	14
2RG-FBA60		2021~2021	32
2RG-FBAV0		2021~2021	5
2RG-FEA20		2021~2021	4
2RG-FEAV0		2021~2021	7
2RG-FEB50		2021~2021	2
2RG-FEB90		2021	1
2TG-FBA00		2021~2021	7
		TOTAL	87