

# VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-3315	DATE	November. 4. 2021
MANUFACTURER	Wuyang-Honda Motors (Guangzhou) Co., Ltd.		
DESCRIPTION OF DEFECT	<p>1) Winker may, due to inadequate manufacturing control over winker switch contacts, induce arc discharge when the winker switch is operated. Metallic particles accumulated on the fixed contact as a result of such arc discharge can make electrical continuity between the contacts and produce heat whereby the contact base holding the fixed contact can be damaged by such heat and this could, in the very worst case, lead to poor electrical continuity and render the winker inoperative.</p> <p>2) Winker may, due to inadequate control over materials of the winker switch component parts, incorporate component parts manufactured from materials not meeting specifications. Such component parts can corrode due to rainwater or the like entered the switch and, in the very worst case, should such corrosion advance and damage the component parts, the winker could be rendered inoperative.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ZAD-EF12	「BENLY e II MD」	2019~2020	1,701
ZAD-EF09	「BENLY e I MD」	2020	500
TOTAL			2,201