

**VEHICLE SAFETY RECALL CAMPAIGN IN JAPAN**

Domestic Vehicles

<b>CAMPAIGN No.</b>	<b>5056</b>	<b>DATE</b>	<b>NOV. 25, 2021</b>
<b>MANUFACTURER</b>	<b>SUZUKI MOTOR CORPORATION</b>		
<b>DESCRIPTION OF DEFECT</b>	<p>The oil control valve, that controls the operation of the exhaust side hydraulic VVT (Variable Valve Timing mechanism) in R06A engine, may have the malfunction, due to the internal parts corrosion caused by the salty water ingress through the front grill.</p> <p>Due to the above, the VVT control may fail to operate, the engine warning lamp may illuminate and the engine may stall just before the vehicle comes to a halt.</p>		

<b>TYPE</b>	<b>COMMERCIAL NAME</b>	<b>MODEL YEAR RECALLED</b>	<b>NUMBER OF VEHICLES</b>	<b>NOTE</b>
DBA-MR31S	HUSTLER	2017~2019	15,709	N/A (Normal Aspiration) Vehicles only
DAA-MR41S			119,316	
DBA-MK32S	SPACIA	2017	327	
DAA-MK42S			41,961	
DAA-MS41S	FLAIR CROSSOVER	2017~2019	7,329	
DBA-MM32S	FLAIR WAGON	2017	144	
DAA-MM42S			3,592	
		<b>TOTAL</b>	<b>188,378</b>	