

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	5072	DATE	December 14, 2021
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	In front axle of road stabilizer, hub shafts crack when the vehicle is turned at high speed due to insufficient durability of the hub shaft. If the vehicle is continued to be used as the same condition, the crack may develop and in the worst case, the hub shaft may break, and the tire may fall off the vehicle.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
GC380F1	「GC380F-1」	1988-1995	1
GC380F2	「GC380F-2」	1995-2004	44
SD-GC001	「GC380F-2」	2004-2005	8
SD-GC001A	「GC380F-2」	2006	1
TOTAL			54