

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic ~~Import Vehicles~~

CAMPAIGN No.	Gai-3331	DATE	December 17, 2021
MANUFACTURE	General Motors Company (Japanese Importer : General Motors Japan Ltd. )		
DESCRIPTION OF DEFECT	General Motors has decided that a defect, which relates to motor vehicle safety, exists in certain 2010 to 2016 model year Cadillac SRX. These vehicles may have received improper service requiring adjustment of a rear suspension toe link. In rare cases, dealers or independent repair shops may not have followed GM's published procedures for torquing the jam nut in the toe link adjusters to the proper specification. A loose toe link can cause the vehicle to sway or wander at highway speeds or allow water or other corrosive elements to enter the threads within the adjuster. If a toe link is improperly adjusted, corrosion combined with vehicle motion may eventually cause the threads within the link to wear and loosen. In very rare cases with continued use, the link could separate. Separation while the vehicle is being driven increases the risk of a crash.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
「ABA-T166C」	「SRX」	2011 – 2016	1108
		TOTAL	1108