

# VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5095	DATE	February. 3. 2022
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>Engine may have an oil cooler outlet pipe the resin hose portion of which was inadequately heat-insulated. In the event the vehicle follows a preceding heavy duty truck or similar vehicle while keeping a short following distance with the engine running in the high-rpm range in the first gear, the hose surface may be melted by the radiant heat from the exhaust pipe. If the vehicle continues in service, the hose can eventually crack and cause engine oil to leak. Leaked oil can get in the exhaust pipe and cause smoking and could, in the very worst case, stick to the rear tire and cause the vehicle to skid and fall over.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2BL-SC82	「CBR1000RR-R」	2020～2021	1,474
TOTAL			1,474