

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5114	DATE	March 15, 2022
MANUFACTURER	KUBOTA Corporation		
DESCRIPTION OF DEFECT	①In some wire harnesses in the engine room of agricultural tractors, the wire harness and the slide frame of the air conditioner condenser are in contact with each other due to improper handling. Therefore, vibration during traveling or rubbing against the slide frame may damage the coating of the wire harness due to wear, short-circuit the internal electric wire, and in the worst case, burn the wire harness and cause a fire. ②Some wire harnesses in the engine room of agricultural tractors are in contact with the battery fixing bolts due to improper handling. Therefore, due to vibration during traveling or the like, the coating of the wire harness may be damaged due to wear and the internal electric wire may be short-circuited, and in the worst case, the wire harness may be burnt out and cause a fire.		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
XDN-MRX YDN-MRX	「MR60」	2015～2021	445
	「MR60-PC」		
	「MR65」	2015～2021	1,054
	「MR65-PC」		
	「MR70」	2015～2021	1,346
	「MR70-PC」		
WDP-MRZ	「MR77」	2014～2017	868
	「MR77-PC」		
	「MR87」	2014～2017	597
	「MR87-PC」		
	「MR97」	2014～2017	2,259
	「MR97-PC」		
「MR97-AT」			
XDN-MRX YDN-MRX	「GV60」	2015～2021	81
	「GVK60」		
	「GV65」	2015～2021	96
	「GVK65」		
	「GV70」	2015～2021	123
	「GVK70」		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
WDP-MRZ	「GV77」	2014~2017	80
	「GVK77」		
	「GV87」	2014~2017	87
	「GVK87」		
	「GV97」	2014~2017	189
	「GVK97」		
XDN-MRX YDN-MRX	「T2.65」	2015~2021	553
(TOTAL 3 TYPES)	(TOTAL 26 MODELS)	TOTAL	7,778

[Notes]

The range of vehicle numbers for recalled vehicles may include vehicles that are not.