

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	5 1 0 7	DATE	1. Mar. 2022
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>① Due to an inappropriate program of the engine control unit, an air-fuel mixture that is drawn in the combustion chamber may become lean if the amount of squeeze of the clutch lever is small when the throttle is closed and the clutch lever is squeezed during deceleration. As the result, the engine may stall in the worst case.</p> <p>② Due to an inappropriate program of the engine control unit, an air-fuel mixture that is drawn in the combustion chamber may become lean if the throttle is opened slightly from the idling state. As the result, the engine may stall in the worst case.</p> <p>③ Due to an inappropriate program of the engine control unit, electric current that flows to the motor that rotates the throttle body valve is cut off and the engine warning lamp turns on. As the result, the throttle body valve cannot be operated, and the vehicle may become unable to run in the worst case.</p> <p>④ Due to an inappropriate program of the engine control unit, the engine warning lamp does not turn on even when parts or a system become broken.</p> <p>Therefore, the subject models do not conform to Appendix 115 (the technical standards for On-Board Diagnostics) of Article 31 of the Safety Standards.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
8BL-RN70J	TRACER900 GT	2021~2022	809
8BL-RN69J	MT-09 MT-09 SP	2021~2022	1004
		TOTAL	1813