

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

~~Domestic~~ / Import Vehicles

|                       |  |      |               |
|-----------------------|--|------|---------------|
| CAMPAIGN No.          | GAI 3463   | DATE | Aug. 24, 2022 |
| MANUFACTURE           | SCANIA CV AB<br>(Japanese Importer: SCANIA JAPAN Co. Ltd. )  |      |               |
| DESCRIPTION OF DEFECT | <p>Some vehicles do not have wiring for EBS communication and ABS failure detection installed in the wiring from the EBS (Electronic Brake System) control unit to the trailer connection socket. For this reason, when a trailer with EBS function is connected, the EBS warning light illuminates and the EBS function does not work. In addition, when a trailer with EBS or ABS function is connected, even if an electrical malfunction occurs in the ABS function on the trailer side, it cannot be detected and the warning light does not come on, so the driver may continue driving without recognizing the malfunction, and in the worst case, the vehicle behavior may become unstable during emergency braking.</p> |      |               |

| TYPE   | COMMERCIAL NAME    | MODEL YEAR RECALLED | NUMBER OF VEHICLE |
|--------|--------------------|---------------------|-------------------|
| SCANIA | LPGRS series Truck | 2020-2021           | 2                 |
|        |                    | TOTAL               | 2                 |