

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	Gai-3481	DATE	Oct. 14. 2022
MANUFACTURER	Ford Motor Company		
DESCRIPTION OF DEFECT	<p>SAFETY RECALL: MKX - Driver Airbag Inflator Replacement - Safety Recall</p> <p>On the affected vehicles, the propellant in the Takata airbag inflators can experience an alteration over time with exposure to certain climate conditions. A combination of time, high temperature fluctuations, and humidity contribute to the degradation of the propellant in the inflators. This degradation can cause the propellant to burn too quickly, creating high pressure inside the inflator, and in extreme cases causing the inflator to rupture in the event of a crash necessitating airbag deployment. A ruptured inflator can send inflator parts toward vehicle occupants resulting in serious injury or death.</p> <p>Dealers are to replace the driver frontal airbag inflator or module and related components. This service must be performed on all affected vehicles at no charge to the vehicle owner.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
Unknown	MKX	2008	94 units
	MKX	2009	79 units
	MKX	2010	32 units
		TOTAL	205 units