

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	Gai-3516	DATE	Nov. 25. 2022
MANUFACTURER	Ford Motor Company		
DESCRIPTION OF DEFECT	<p>SAFETY RECALL: Mustang - Brake Stop Lamps Remain On / brake pedal "stop bumper" Replacement</p> <p>In the affected vehicles, Exposure to a high temperature, high humidity, and high salinity environment is causing the brake pedal "stop bumper" to disintegrate and fall off on some of the affected vehicles resulting in the brake stop lamps remaining on continuously, even when the brake pedal is not applied. If the brake pedal stop bumper is missing on automatic transmission vehicles, the engine can be started, and the transmission can shift out of park without depressing the brake pedal.</p> <p>Dealers are to replace the brake pedal stop bumper. This service must be performed on all affected vehicles at no charge to the vehicle owner.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
Unknown	Ford Mustang 2.3L	2015	585 units
TOTAL			585 units