

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	Gai-3550	DATE	Jan. 27. 2023
MANUFACTURER	Ford Motor Company		
DESCRIPTION OF DEFECT	<p>SAFETY RECALL: Navigator - Brake Master Cylinder Replacement -</p> <p>In some of the affected vehicles, a seal in the rear of the brake master cylinder may become compromised, allowing brake fluid to leak into the brake booster. If the brake fluid reservoir is depleted below a predetermined level, the driver will be alerted that brake system service is required by a combination of the following:</p> <ul style="list-style-type: none"> <li>· An audible chime</li> <li>· A full screen message Centre alert</li> <li>· Illumination of the red brake warning indicator</li> </ul> <p>If the brake fluid reservoir continues to be depleted, the driver may experience a change in brake pedal travel and feel, and reduced brake function in the front wheels without affecting brake function in the rear wheels. Reduced brake function in the front wheels can extend stopping distance, increasing the risk of a crash.</p> <p>Dealers are to replace the brake master cylinder. If indications of a leak are present between the brake master cylinder and brake booster, dealers are also to replace the brake booster.</p> <p>This service must be performed on all affected vehicles at no charge to the vehicle owner.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
Unknown	Lincoln Navigator	2016	20 units
TOTAL			20 units