

## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-3603	DATE	April. 5. 2023
MANUFACTURER	Thai Honda. Co., Ltd.		
DESCRIPTION OF DEFECT	For some motors, paint is stuck on the fitting part of the sealing plug due to the inappropriate process of manufacturing the right-side crankcase cover. Because of this, the heat generated by the engine, etc. lowers the retentiveness of the sealing plug and if the motor continues to be used, the sealing plug will fall out, spurting the engine oil. In the worst-case scenario, there are the risks of the rider's getting burned if the scattered engine oil sticks the rider, of fire if it sticks on the hot part of the exhaust pipe, and of the motorcycle's falling if it sticks on the rear tire.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
8BK-MC49	「Rebel 250」	2022	3,584
8BK-MC52	「CB250R」	2022	1,243
8BK-MD47	「CRF250L」 「CRF250 RALLY」	2022	594
TOTAL			5,421